



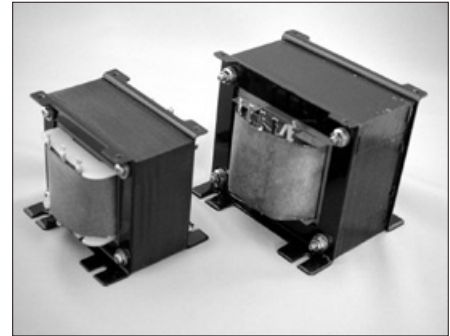

# High Quality Transformers

## S 型電源トランス標準寸法表

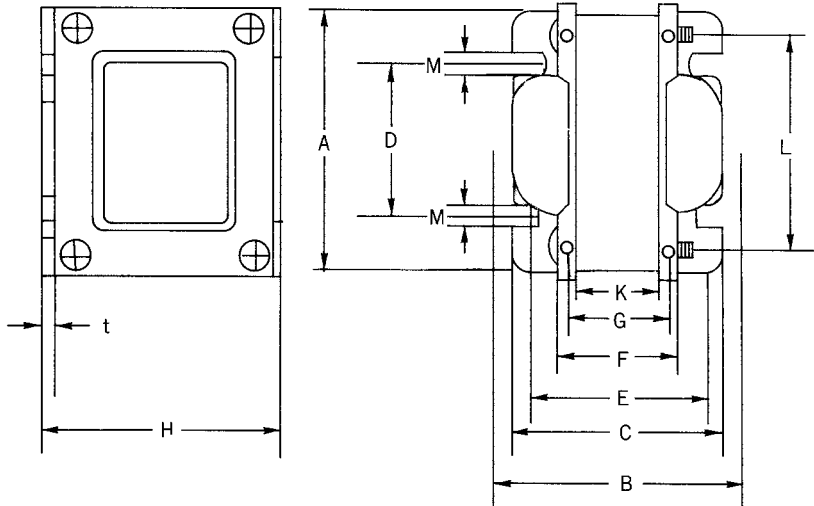

型名	A ±3	B ±10	C ±3	H ±3	D ±1	M ±1.0	E ±2.5	F ±3	G ±3	K ±3	L ±1.5	t	標準電力 VA	電圧変動率約 ε %
SG7630	78	65	62	68	55	4.5	50	50	42	30	65	1.2	46	9.5
SG7635	78	70	67	68	55	4.5	55	55	47	35	65	1.2	51	8.5
SG7640	78	75	72	68	55	4.5	60	60	52	40	65	1.2	56	8.0
SG7650	78	85	82	68	55	4.5	70	70	62	50	65	1.2	70	7.2
SH8530	86	68	66	76	60	4.5	50	50	42	30	75	1.2	71	7.3
SH8540	86	78	76	76	60	4.5	60	60	52	40	75	1.2	88	6.4
SH8550	86	88	86	76	60	4.5	70	70	62	50	75	1.2	104	5.5
SH8560	86	98	96	76	60	4.5	80	80	72	60	75	1.2	125	5.1
SI9640	97	82	76	86	70	4.5	60	60	52	40	85	1.4-1.6	109	6.3
SI9650	97	92	86	86	70	4.5	70	70	62	50	85	1.4-1.6	136	5.5
SI9660	97	102	96	86	70	4.5	80	80	72	60	85	1.4-1.6	146	4.9
SJ10540	106	86	80	93	80	4.5	60	60	52	40	95	1.6	137	5.9
SJ10550	106	96	90	93	80	4.5	70	70	62	50	95	1.6	159	4.8
SJ10560	106	106	100	93	80	4.5	80	80	72	60	95	1.6	183	4.6
SK11450	115	100	100	100	85	6.5	70	70	62	50	105	1.6	195	4.4
SK11460	115	110	110	100	85	6.5	80	80	72	60	105	1.6	223	4.2
SK11470	115	120	120	100	85	6.5	90	90	82	70	105	1.6	260	3.9
SL1 3350	133	106	100	117	95	6.5	70	70	62	50	120	1.6	309	4.6
SL1 3360	133	116	110	117	95	6.5	80	80	72	60	120	1.6	372	4.1
SL1 3370	133	126	120	117	95	6.5	90	90	82	70	120	1.6	430	3.1

傍らにいて教え導くは常道、邪道に入るを戒めるのは時を得た教え